## Preparing Custom Solder Paste Stencils for a Laser Cutter Using Cadsoft Eagle and Autodesk AutoCAD

Sam DeBruin • November 16th, 2011

1. In the Eagle board editor, go to Options -> User Interface and set the layout background to white

AGLE File Edit Draw	View Tools	Library	Options	Window	Help
a 💈 🕈 🗰 🕮	M 9, 9,	9. 9.	Assign. Set User int	 terface	1 Board – /Users/Sam/Dropb
(AF 1-1 ( A 40 A 90 ) [ [		🖬 User i	nterface		
Controls			Layout		
✓ Pulldown menu ✓ Action toolbar			Backgrour Cursor:	nd: 🔵 Black 💽 Small	• • White Colored
Command buttons			Schematic		
Command texts Sheet thumbnails			Backgrour Cursor:	nd: 🔵 Black 💽 Small	: • White Colored
Misc					
<ul> <li>Always vector font</li> <li>Persistent in this</li> <li>Limit zoom factor</li> <li>Mouse wheel zoom</li> <li>External text editor</li> </ul>	drawing		d Bubble he	lp	
			🕙 User guid	ance	Cancel OK

- 2. Go to View -> Display/hide layers and disable all layers except for Dimension and tCream
- 4. In the command line, type 'run' and press enter
- 5. Navigate to the EAGLE directory (if not there already) and select ulp -> dxf.ulp

000	ALL LE L	Run	
	I 📄 ulp	\$	٩
FAVORITES Dropbox Applications Desktop Documents Downloads Movies Movies Music eagle SHARED Dan Cohen's DEVICES Sam's MacBoo	<ul> <li>bin</li> <li>cam</li> <li>doc</li> <li>dru</li> <li>EAGLE</li> <li>lbr</li> <li>projects</li> <li>scr</li> <li>ulp</li> </ul>	<ul> <li>designimk-inc.up</li> <li>designink-inc.up</li> <li>designink-order.up</li> <li>designink-order.up</li> <li>dif40.up</li> <li>dif40.up</li> <li>dose-pro.ulp</li> <li>drill-gaup</li> <li>drill-gaup</li> <li>drillegend.ulp</li> <li>drillegend.ulp</li> <li>e-bauteil-erstellen.ulp</li> <li>e-brueckewaltung.ulp</li> <li>e-kenmenplan.ulp</li> <li>e-makelist.ulp</li> <li>e-packagedname.ulp</li> <li>edit-usedac-sym.ulp</li> <li>editnext-dym-pac.ulp</li> </ul>	♥ Preview: Name dxf.ulp Kind EACLE User Language Program Size 49 KB on disk Created 1/11/10 11:07 PM Modified 1/11/10 11:07 PM Last opened 1/11/10 11:07 PM More info
			Cancel Open

7. Use whatever units were predominately used to create the board but include the unit system in the dxf file's title for reference

Ea	gle: DXF Converter			
Output file %N mm.dx	f			
output inc program				
Always vector font				
If checked, texts will always be drawn with the builtin vector font.				
Use wire widths	Use wire widths			
If checked, wires, arcs and circ real widths. This, however, can this if you do not need the real	les will be generated as polygons showing their n cause the DXF file to become very large! Uncheck l widths.			
□ Fill areas				
If checked, wires, arcs etc. will	l be filled (implies 'Use wire widths'!).			
Unit				
💿 mm	Defines the unit used for coordinates			
⊖ inch	and values in the DXF file			
	OK Cancel About			

6. Uncheck 'Use Wire Widths' and 'Fill Areas' and click ok

7. Open AutoCAD (available on the CAEN computers or CAEN remote desktop) and open your dxf file

For more information on AutoCAD, visit <a href="http://usa.autodesk.com/autocad/training/">http://usa.autodesk.com/autocad/training/</a>

8. Pads with fine pitch (> 1 mm) need to be made smaller to accommodate for the non-zero width of the laser cutter. Select pads with fine pitch, right click, and select 'Properties'



9. In the Properties menu, find the values 'Scale X' and 'Scale Y' under 'Geometry'. Whichever of these values is smaller is your pitch (usually)

	F USILIUTI Z	0.0000	
~3	Scale X	0.0630	
	Scale Y	0.0177	
	Scale 7	1 0000	

10. Using the calculator icon on the left, multiply your pitch value by 0.5 (50%) and click apply

A QuickCalc
🥖 🞯   🖄 🚟 🐴 🗙   😰
0.0177*.5 0.00885
0.00885
Property Calculation
Number Pad
$\begin{array}{c ccccccccccccccccccccccccccccccccccc$
Scientific <b>•</b>
Units Conversion 🔹
Variables
Apply Close Help

11. Do this for all fine pitch parts. Be mindful of any area that may be affected by a non-zero cutting width.

12. The Dimension layer is important because it allows the stencil edges to line up with the board, but it also prints all non-plated drills in the board. This causes these holes to fill up with solder during the assembly process, potentially closing those holes.

To eliminate this, if applicable, manually delete all non-plated drills in AutoCAD. This is typically all round shapes in this dxf representation

12. Save this file as a dxf. Final formatting will occur at the laser cutter. Place your dxf on a flash drive